CLUTTONS
Chartered Surveyors • Property Consultants


Job No.	27266.03
By	M.L.
Date	28-6-22
Sheet	S-00221 T1

Project: 53 WARMINSTER RD, LONDON SE25 4DA
REMOVAL OF BURIED TANK

FRONT VIEW




SIDE ELEVATION

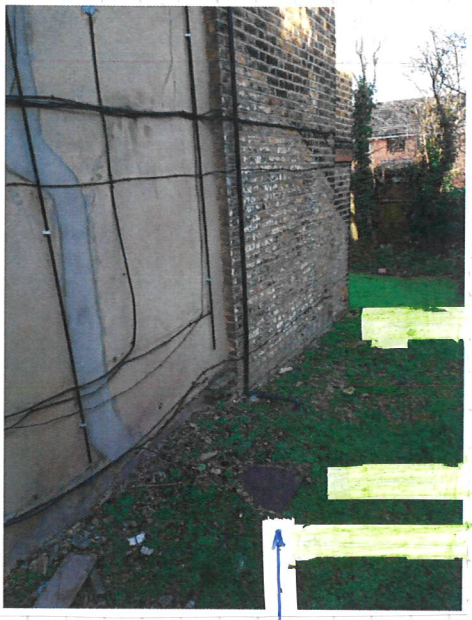

PART-BURIED STEEL/C.I. TANK

REAR

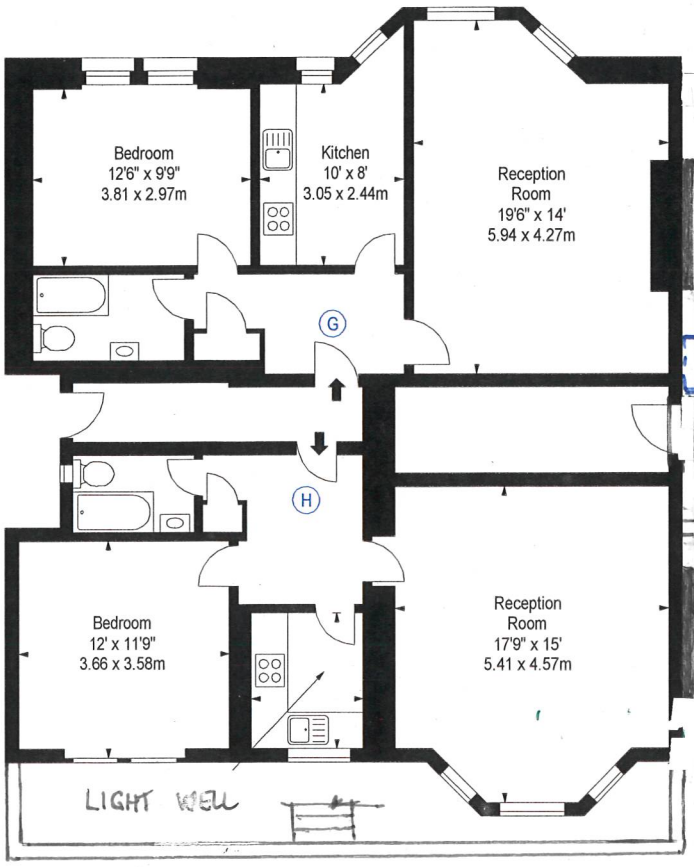

BURIED METAL TANK

GARDEN WALL STEP IN HEIGHT

FRONT

LOWER GROUND FLOOR

NOTES

1. SEQUENCE FOR REMOVAL OF BURIED TANK:
   a) EXCAVATE AROUND WITH HAND-HELD TOOLS
   b) NOTIFY ENGINEER IF TANK EXTENDS BENEATH WALL & SUBMIT METHOD FOR REMOVAL
   c) CHECK FOR ANY CONNECTIONS TO TANK
   d) ONCE METHOD AGREED, CAREFULLY REMOVE TANK & DISPOSE OF
   e) BACKFILL WITH COMPACTED ORIGINAL MATERIAL IN 250 THK LAYERS
   f) REINSTATE TOPSOIL


2. COORDINATE EXCAVATION OF TANK WITH ACCESS FOR RESTRAINT TO SOUTH GABLE WALL. REF. SHT. S-00220

CLUTTONS
Chartered Surveyors • Property Consultants


Job No.	27266.03
By	ML
Date	28-6-22
Sheet	S-00222 T1

Project: 53 WARMINSTER RD, LONDON SE25 4DQ


BRICKWORK CRACK REPAIR

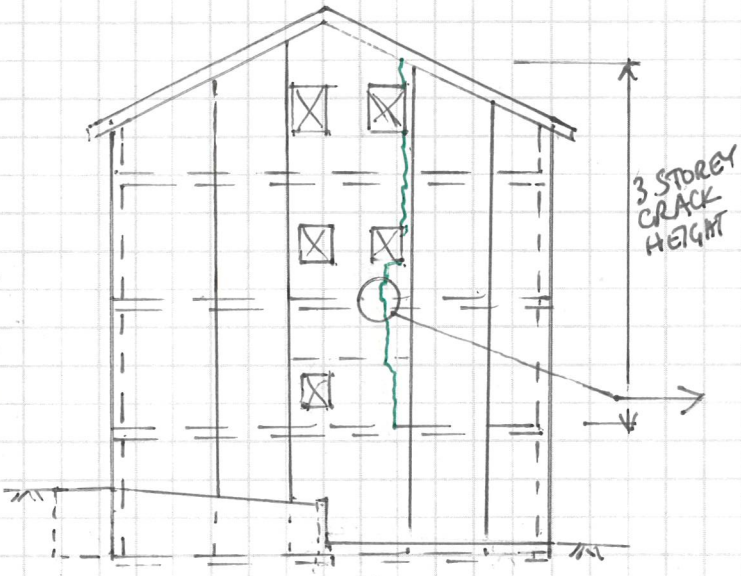


SECTION D-D
EXTERNAL FACE

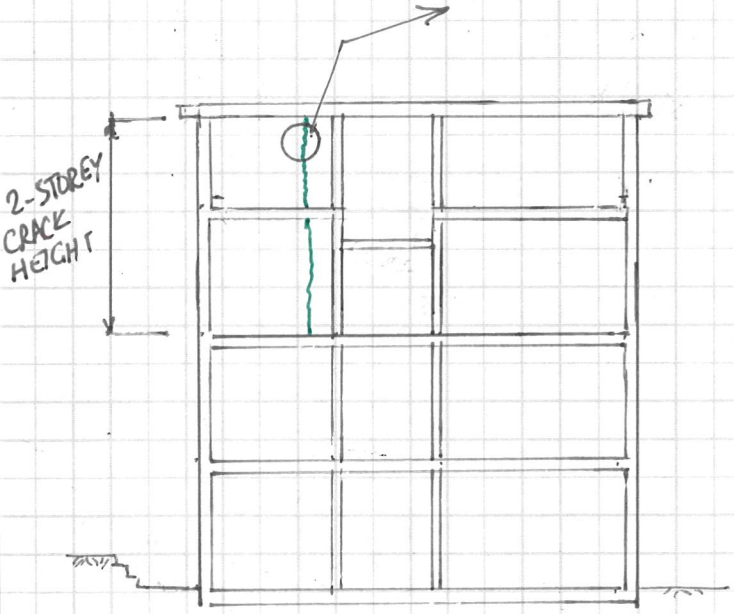

SECTION C-C
INTERNAL FACE

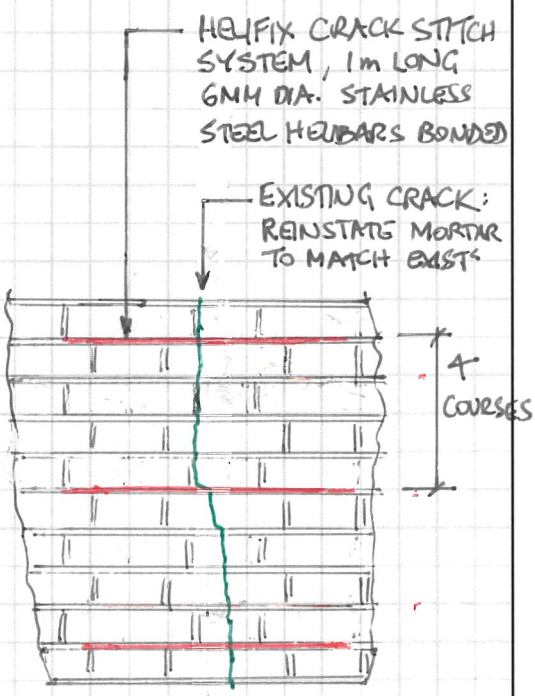

BRICKWORK CRACK REPAIR DETAIL

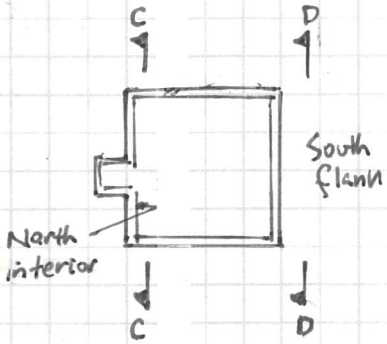

KEY PLAN
EXT. WALLS